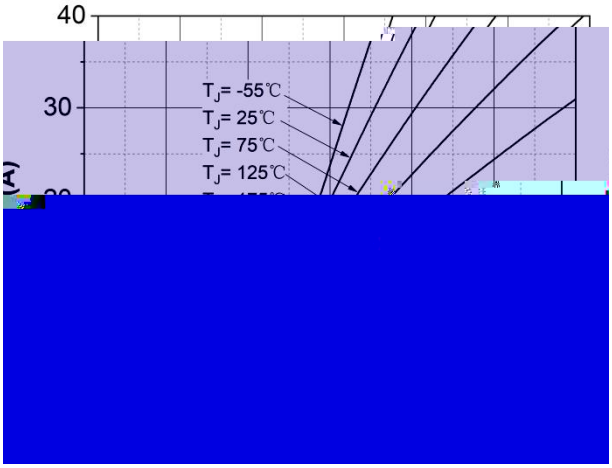
40
30
T_J= -55℃
T_J= 25℃
T_J= 75℃
T_J= 125℃

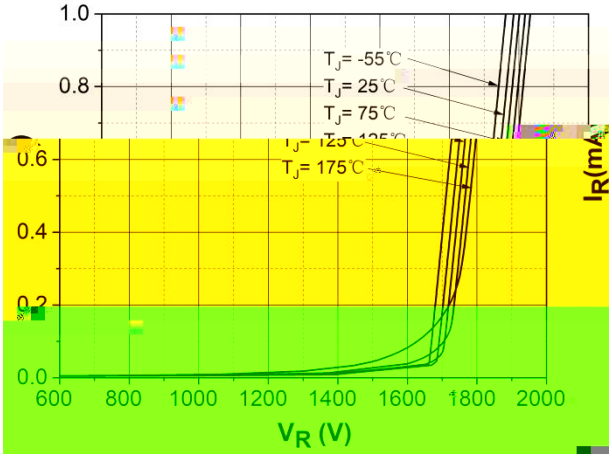
1.0
0.8
0.6
0.4
0.2
0.0
600
800
1000
1200
1400
1600
1800
2000
V_R (V)
T_J= -55℃
T_J= 25℃
T_J= 75℃
T_J= 175℃

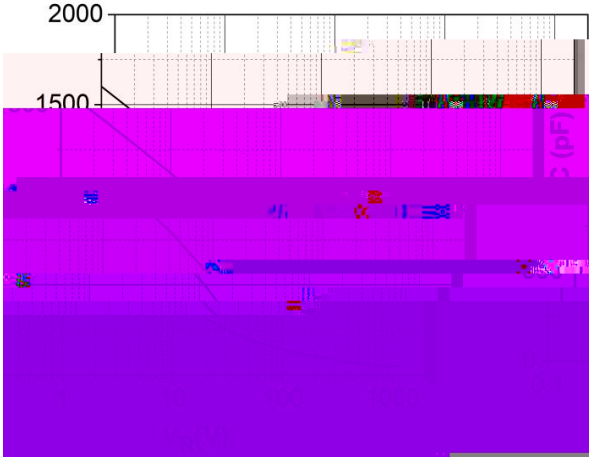
2000
1500

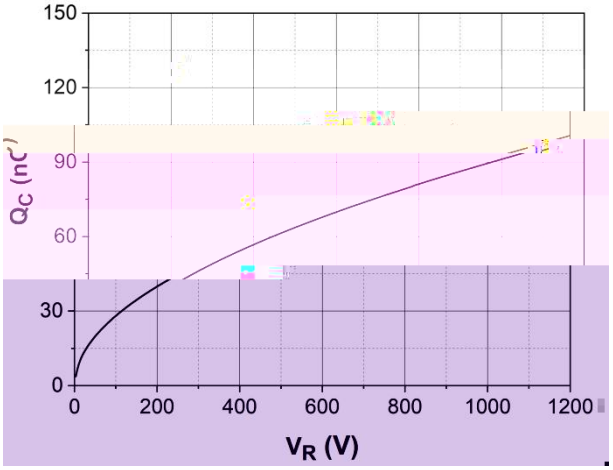
150
120
90
60
30
0
Q_C (nC)
0
200
400
600
800
1000
1200
V_R (V)

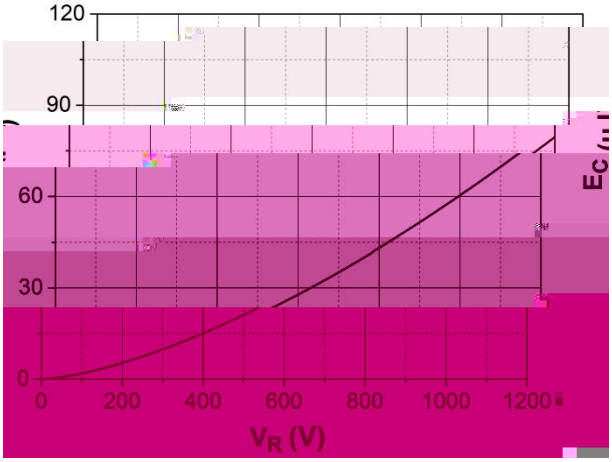
120
90
60
30
0
0
200
400
600
800
1000
1200
V_R (V)

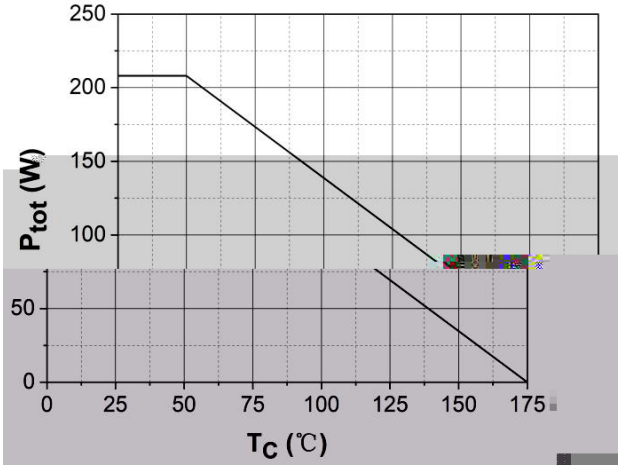
250
200
150
100
50
0
P_{tot} (W)
0
25
50
75
100
125
150
175
T_C (℃)

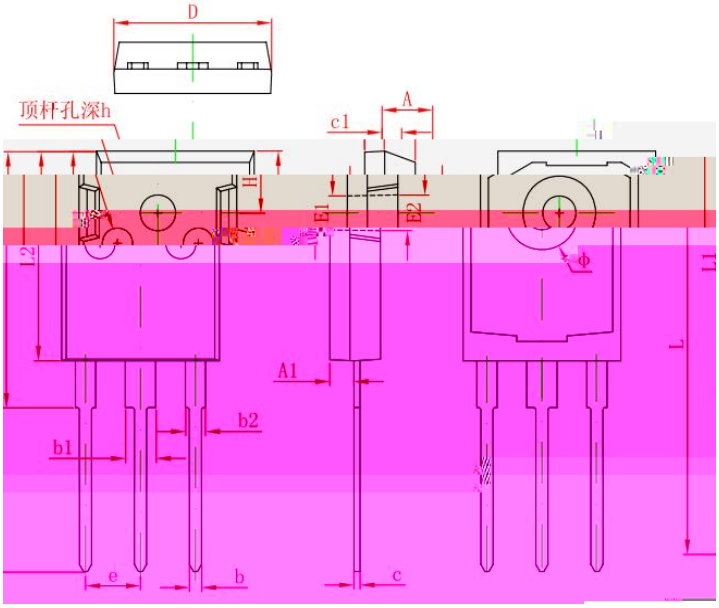

Symbol	Dimensions In Millimeters		Dimensions In Inches	
	Min	Max	Min	Max
A	4.850	5.150	0.191	0.200
A1	2.200	2.600	0.087	0.102
b	1.000	1.400	0.039	[illegible]
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
E1	3.500 REF		0.138 REF	
E2	3.600 REF		0.142 REF	
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]

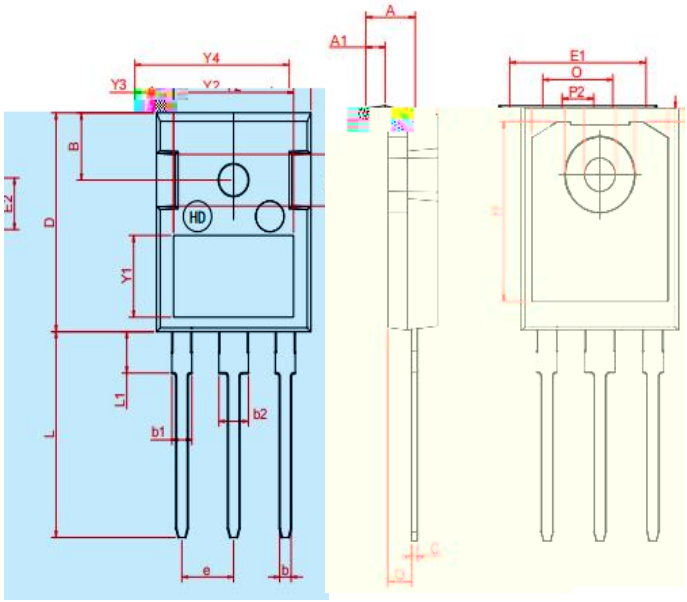

Symbol	Dimensions In Millimeters		Dimensions In Inches	
	Min	Max	Min	Max
A	4.700	5.300	0.185	0.209
A1	1.700	2.300	0.067	0.091
C	0.450	0.750	0.018	0.030
Q	2.200	2.600	0.087	0.102
O	7.100	7.400	0.280	0.291
P2	3.450	3.750	0.136	0.148
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
b2	3.000	3.300	0.118	0.130
e	5.250	5.550	0.207	0.219
D	20.950	21.350	0.825	0.841
Y1	7.600	8.100	0.299	0.319
Y2	11.000	13.000	0.433	[illegible]
[illegible]	[illegible]	2.250	0.069	[illegible]
Y4	16.000	16.400	0.630	[illegible]
E2	4.600	4.900	0.181	[illegible]

		— —
		— —
		— —
		— —
		— —